

TALO

Field Assembled Extrusion - Surface

SEE THIS EXTRUSION AS A FACTORY BUILT FIXTURE ▶

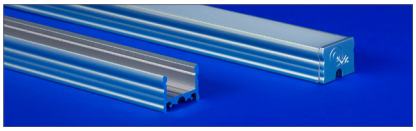



- TALO's modern design is complemented by its sleek flat lens and end caps that promote full luminosity
- Utilizes a hidden stainless steel mounting clip
- Compatible with a plastic T-Bar clip for grid ceiling applications
- Can be used with LEDs up to 6.0 W/ft

1 PRODUCT	2 FINISH	3 MOUNTING	4 LENS	5 WIRE INPUT/OUTPUT	6 EXTRUSION LENGTH (IN)
TALO				NI	

Sample Part Number: **TALO-ST-HSS-DF-NI-48"**

1 PRODUCT

TALO

2 FINISH

ST	Satin
BK	Black
CU	Custom Color

Custom finishes require a longer lead time, consult factory

3 MOUNTING

HSS	Hidden Stainless Steel Clip
TBC-01	9/16" Flat or Tegular TB-Grid
TBC-02	15/16" Flat or Tegular TB-Grid

Refer to following pages for mounting clip option details and provided quantities.

4 LENS

DF	Diffused
PR	Polar
FR	Frosted

For representation of LED visibility, see Diode Visibility section on following pages.
For beam angles, see Photometric Performance section on following pages.

5 WIRE INPUT/OUTPUT

NI Not Installed

6 EXTRUSION LENGTH (IN)

1" increments from 1" - 98.43"
Tolerance +0.0"/-0.5"

COMPATIBLE LED STRIPS

	STATIC WHITE (SW)	STATIC WHITE STANDARD (SD-SW)	STATIC WHITE HIGH EFFICACY (SW-HE)	STATIC WHITE HIGH EFFICACY PLUS (SW-HE+)	STATIC WHITE EXTREME TEMP (SW-XT)	SHIELD STATIC WHITE (SHLD-SW)	SHIELD STATIC WHITE HIGH EFFICACY (SHLD-SW-HE)	DYNAMIC WHITE HIGH EFFICACY (DW-HE)	WARM DIM (WD)	STATIC COLOR (SC)	RGB	RGBW	RGBW HIGH EFFICACY (RGBW-HE)
DRY	✓ W/FT: 1.5, 3.0, 4.0, 5.0	✓ W/FT: 1.0, 2.0, 4.0, 6.0	✓ W/FT: 1.5, 3.0, 6.0, 9.0	✓ W/FT: 3.0, 6.0		✓ W/FT: 1.5, 3.0, 5.0	✓ W/FT: 1.5, 3.0, 6.0	✓ W/FT: 1.5, 2.5, 4.0	✓ W/FT: 6.0	✓ W/FT: 5.0	✓ W/FT: 6.0	✓ W/FT: 6.0	✓ W/FT: 4.0, 8.0
DMP	✓ W/FT: 1.5, 3.0, 4.0, 5.0		✓ W/FT: 1.5, 3.0, 6.0					✓ W/FT: 1.5, 2.5	✓ W/FT: 6.0	✓ W/FT: 5.0	✓ W/FT: 6.0	✓ W/FT: 6.0	✓ W/FT: 4.0
ENC	✓ W/FT: 1.5, 3.0, 4.0, 5.0		✓ W/FT: 1.5, 3.0, 6.0					✓ W/FT: 1.5, 2.5		✓ W/FT: 5.0	✓ W/FT: 6.0	✓ W/FT: 6.0	✓ W/FT: 4.0
WET	✓ W/FT: 1.5, 3.0, 4.0, 5.0	✓ W/FT: 1.0, 2.0, 4.0		✓ W/FT: 3.0, 6.0	✓ W/FT: 3.0	✓ W/FT: 1.5, 3.0, 5.0	✓ W/FT: 1.5, 3.0, 6.0	✓ W/FT: 1.5, 2.5	✓ W/FT: 6.0	✓ W/FT: 5.0	✓ W/FT: 6.0		✓ W/FT: 4.0

Field modifications must comply with QTL's installation methods otherwise warranty is null & void | Surface mount | Painted end caps match the extrusion finish and have a white painted interior. Satin end caps utilize a metallic paint.

© 2026 QTL. All rights reserved | 155 Hill St. Milford, CT 06460 | 203-367-8777 | sales@QTL.lighting | www.QTL.lighting


Specification subject to change. Rev-03-17-26

TALO


Field Assembled Extrusion - Surface

SEE THIS EXTRUSION AS A FACTORY BUILT FIXTURE ▶


1 PRODUCT - DIMENSIONS

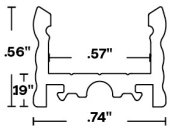


Profile

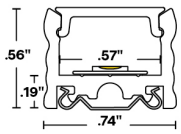

Profile with hidden stainless steel mounting clip

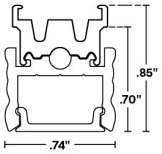

Profile with TBC-01

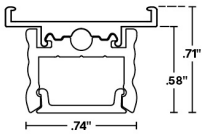


Profile with TBC-02

END CAPS


One pair of end caps is provided with each length of extrusion ordered.

Flat end caps

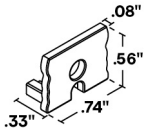

Feed


To order separately, use TALO-EC

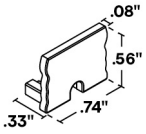

No feed

To order separately, use TALO-EC

2 FINISH




Satin

Black

Custom finishes require a longer lead time, consult factory

3 MOUNTING

HSS




Hidden Stainless Steel Clip

2 clips provided for 4' or less; 4 clips provided for greater than 4'

To order separately use SST-02

Each clip comes with a #4 x 5/8" Flat Head SS

TBC-01

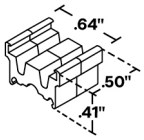


Plastic T-Bar Clip

Use on 9/16" Flat or Tegular Drop Ceiling

2 clips provided for first 12"; 1 clip provided for each additional 12" or less length

To order separately use TBC-01

TBC-02



Plastic T-Bar Clip

Use on 15/16" Flat or Tegular Drop Ceiling

2 clips provided for first 12"; 1 clip provided for each additional 12" or less length

To order separately use TBC-02

© 2026 QTL. All rights reserved | 155 Hill St. Milford, CT 06460 | 203-367-8777 | sales@QTL.lighting | www.QTL.lighting


Specification subject to change. Rev-03-17-26

TALO

Field Assembled Extrusion - Surface

SEE THIS EXTRUSION AS A FACTORY BUILT FIXTURE ▶

4 DIODE VISIBILITY




DF - Diffused lens

PR - Polar lens

FR - Frosted lens

PHOTOMETRIC PERFORMANCE

Nominal beam spread shown, beam spread varies based on light engine. For more detailed information, see factory built fixture photometric data.



80°


COMPATIBLE ACCESSORIES

HINGE - HMB-M



Adjustable mounting bracket - Medium

HINGE - HMB-L



Adjustable mounting bracket - Large

HINGE - HMB-XL



Adjustable mounting bracket - XLarge

Q-PIVOT



Small mounting accessory

Q-ANGLE



Adjustable mounting accessory

VHB



Double sided mounting tape

© 2026 QTL. All rights reserved

TALO LUMEN MULTIPLIER

LUMEN MULTIPLIER FORMULA

Bare LED Lumens x Extrusion Finish/Lens Value = Delivered Lumens

Example: **172 lm/ft x 0.83 = 142 lm/ft**

SW24/1.5 at 3000K x TALO Extrusion in Satin with FR Lens

Diode free or near Diode free

SW			
LENS	Finish		
	Satin	Black	Bronze
	(ST)	(BK)	(BZ)
CL	0.84	0.71	N/A
FR	0.83	0.70	N/A
PR	0.77	0.64	N/A
DF	0.70	0.54	N/A
ENC/CL	0.62	0.40	N/A
ENC/TL	0.32	0.15	N/A

SW-HE			
LENS	Finish		
	Satin	Black	Bronze
	(ST)	(BK)	(BZ)
CL	0.77	0.64	N/A
FR	0.75	0.62	N/A
PR	0.69	0.55	N/A
DF	0.63	0.47	N/A
ENC/CL	0.64	0.42	N/A
ENC/TL	0.47	0.30	N/A

Data is subject to change | All data has +/- 5% tolerance

© 2024 QTL. All rights reserved | 155 Hill St. Milford, CT 06460 | 203-367-8777 | sales@QTL.lighting | QTL.lighting


TALO

Field Assembled Extrusion Installation Instructions

ATTENTION: Please read all instructions BEFORE installation

- Product to be installed by a licensed electrician
- Always ensure power supply connection to electrical circuit is disconnected before working on it
- Follow diagram to connect Secondary Voltage wires to power supply. Refer to QTL power supply instructions for wiring
- Use only with Class 2 power supply unit — Warranty only valid with QTL power supplies
- Surface mount
- Suitable for DRY, DAMP, and WET locations
- Suitable for installation in storage area of a clothes closet when assembled as a finished extrusion up to 4W/ft at QTL facility
- Not rated for walkover
- Input Voltage: 24VDC
- Diagrams for representation only and not to scale
- Once a wet strip or a damp strip is cut, it cannot be reconnected.

METHODS OF INSTALLATION

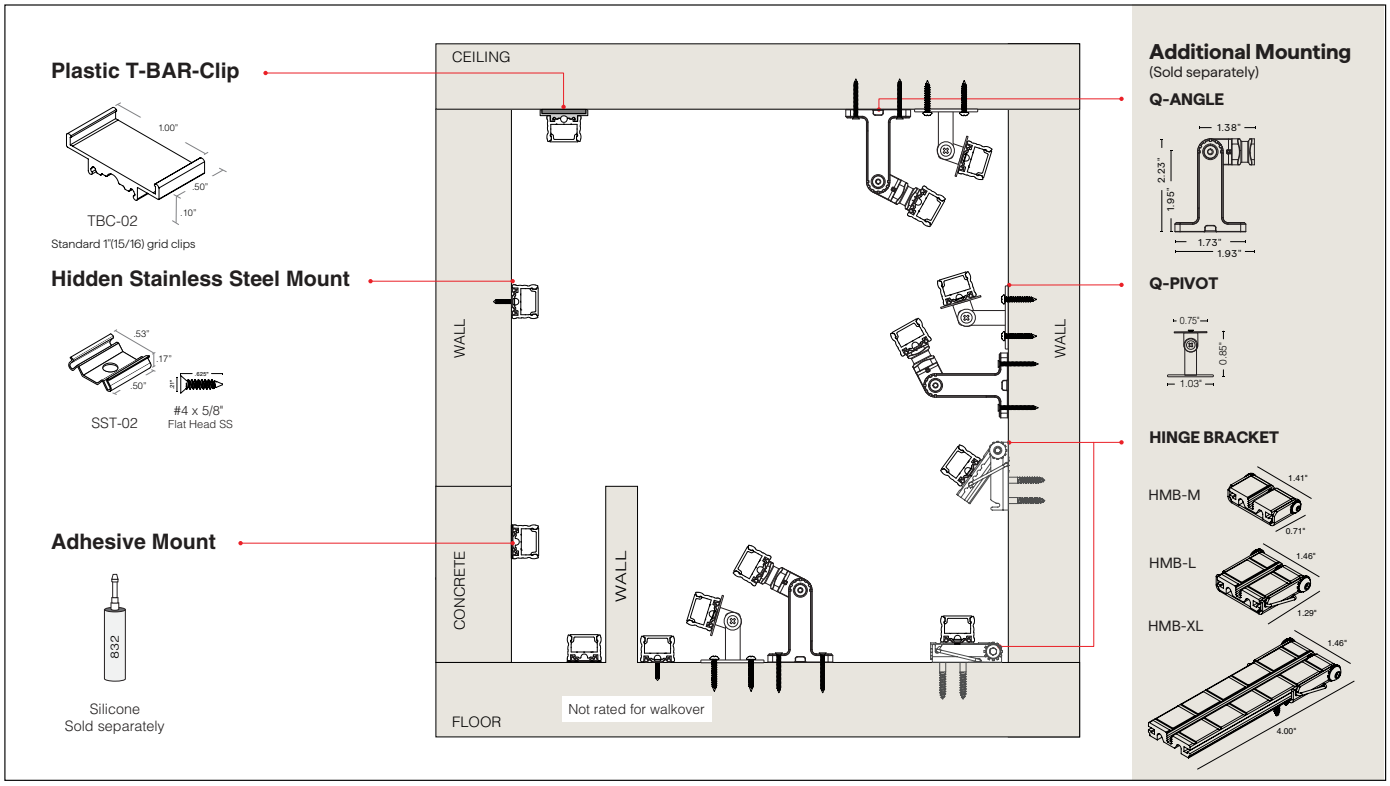

SURFACE MOUNTING METHOD

- Silicone Mount (page 8)
- Hidden Stainless Steel Clip Mount (page 9)
- Plastic T-BAR Clip Mount (page 10)


NOTES:

- *Avoid bending in sharp angles which may damage the LED.*
- *Always test LED operation before installing in extrusion. Connect LED to power supply to ensure it is working properly and all non-factory soldered connections are secure.*
- *Diagrams for representation only and not to scale.*






© 2026 QTL. All rights reserved | 155 Hill St. Milford, CT 06460 | 203-367-8777 | sales@QTL.lighting | QTL.lighting

TALO

Field Assembled Extrusion Installation Instructions

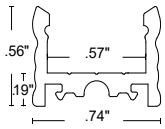


TALO Profile

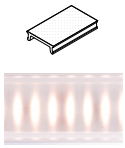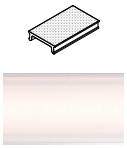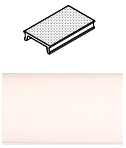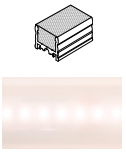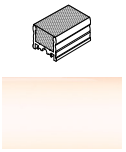FR	PR	DF	ENC/CL	ENC/TL
				
Frosted	Polar	Diffused	Encapsulated in Clear	Encapsulated in Translucent

COMPONENTS & HARDWARE

Alternate screw lengths can be used in installation as long as the screw diameter size is consistent with the included screw diameter size

HIDDEN STAINLESS STEEL CLIP



SST-02

Included	
	Flat Head Screw #4x5/8"

- 2 clips provided for 4' or less; 4 clips provided for greater than 4'


PLASTIC T-BAR CLIP



TBC-01

9/16" Flat or Tegular TB-grid clips

- 2 Clips provided per first 12", 1 clip provided per additional foot.



TBC-02

15/16" Flat or Tegular TB-grid clips

- 2 Clips provided per first 12", 1 clip provided per additional foot.

ACCESSORIES SOLD SEPARATELY

HINGE BRACKET; sold individually





Image shows HMB-M

HMB-M
HMB-L
HMB-XL

Included
• 3/4" long mount screw • 1/4" #4 clip mount screw

Q-ANGLE; sold in pairs



Q-ANGLE

Included
• 2 SS 6-32 Fillister screws • 2 SS 4-40 Flat head clip screws • 4 SS #6x1.25" Flat head wood screws

Q-PIVOT; sold in pairs




Q-PIVOT

Included
• SS #4-40x3/16 Flat head screw • 2 #4x3/4 Pan head screws

ADHESIVE SOLD SEPARATELY



SILICONE



DOWSIL 832

CONNECTOR/WIRE - IN/OUT;


Bare wire can be trimmed to length as needed.

BARE WIRE 24"	BARREL 6"	CONNECTOR 6"	CONNECTOR 24"
			
BW	BRL	CON6	CON24


© 2026 QTL. All rights reserved | 155 Hill St. Milford, CT 06460 | 203-367-8777 | sales@QTL.lighting | QTL.lighting

LED STRIP LEAD WIRE & JUMPER INSTRUCTIONS: **DRY IP20**

If LED wires are pre-soldered from the factory, skip to page 6.

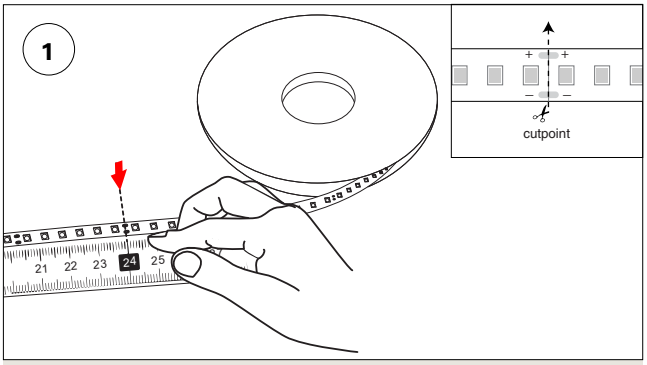


Measure and cut LED strip to desired length with scissors along the cut point.

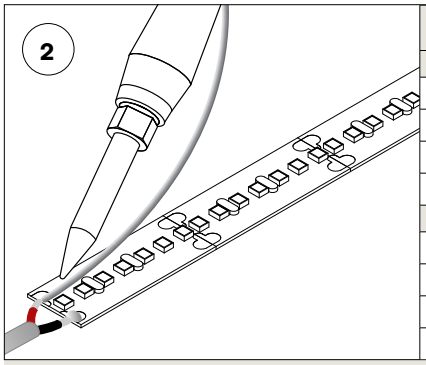


ITEMS INCLUDED
iQ-LED-24-KIT
(1) 24" Lead wire
(1) 6" Solder
(1) 1" Shrink Tube
(1) 1/2" Shrink Tube
iQ-JUMP-6-KIT
(1) 6" Lead wire
(1) 6" Solder
(2) 1" Shrink Tube
(2) 1/2" Shrink Tube

Solder lead wire onto solder pad. Confirm wires are matched up correctly before soldering. See wiring diagrams below for specific light engine details.

NOTE: Recommended soldering iron temperature of 650˚ – 700˚F for lead-free solder.

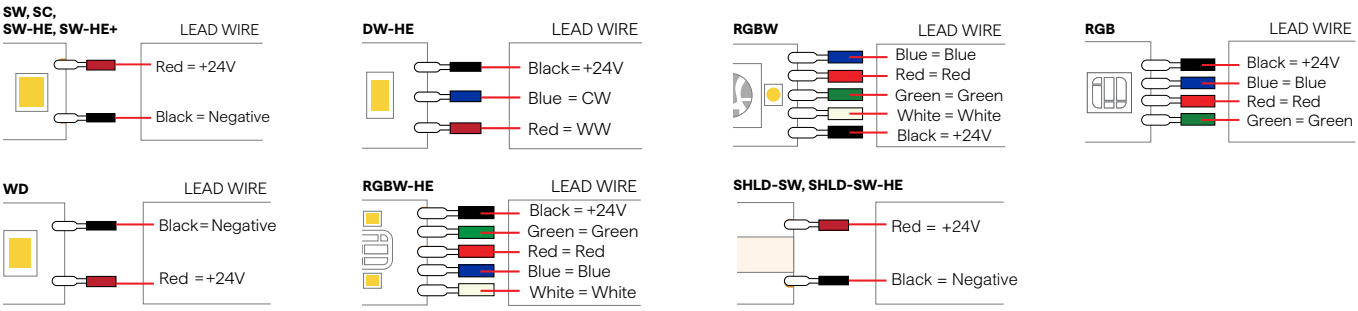

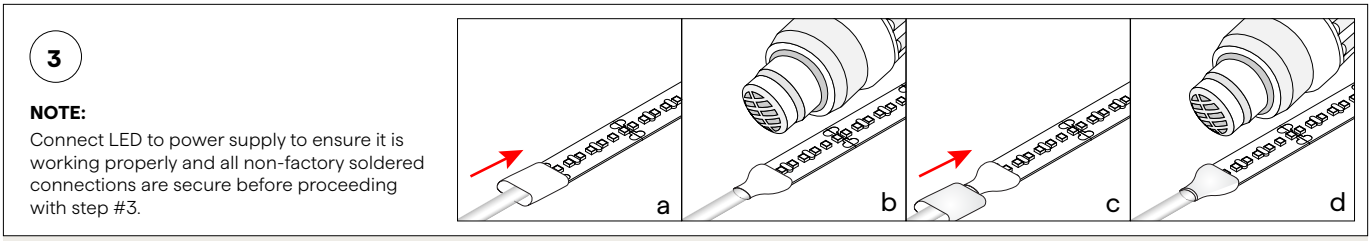

NOTE:
Connect LED to power supply to ensure it is working properly and all non-factory soldered connections are secure before proceeding with step #3.

ONCE ALL CONNECTIONS ARE FUNCTIONING PROPERLY, DISCONNECT POWER AND BEGIN HEAT SHRINKING INSTRUCTIONS BELOW:

a: Place 1st sleeve (1/2" Shrink Tube) on lead wire.

b: Shrink the tube with heat gun.

c: Place 2nd sleeve (1" Shrink Tube) on lead wire.

d: Shrink the tube with heat gun.


NOTES:

- *Avoid bending in sharp angles which may damage the LED.*
- *Always test LED operation before installing in extrusion. Connect LED to power supply to ensure it is working properly and all non-factory soldered connections are secure.*
- *Diagrams for representation only and not to scale.*

© 2026 QTL. All rights reserved | 155 Hill St. Milford, CT 06460 | 203-367-8777 | sales@QTL.lighting | QTL.lighting


LED STRIP LEAD WIRE & JUMPER INSTRUCTIONS: **DMP IP54**

If LED wires are pre-soldered from the factory, skip to page 6.

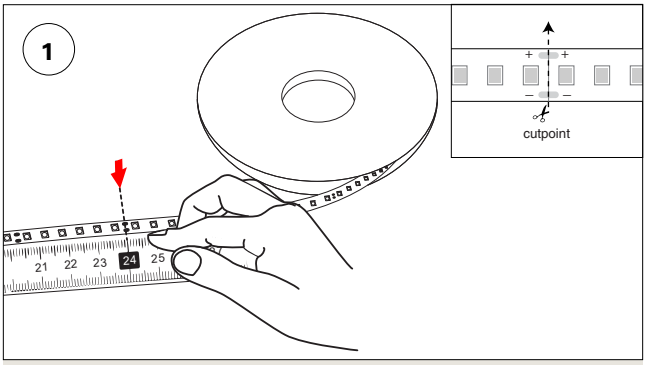

Measure and cut LED strip to desired length with scissors along the cut point.

- Carefully peel polyurethane back to expose the solder pads.

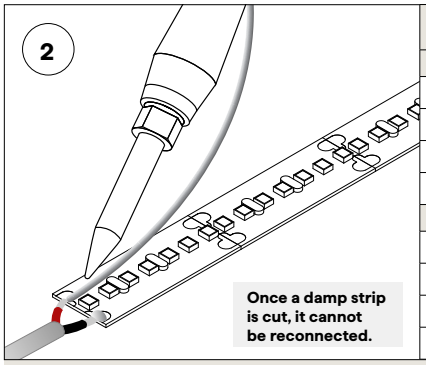

ITEMS INCLUDED
iQ-LED-24-KIT
(1) 24" Lead wire
(1) 6" Solder
(1) 1" Shrink Tube
(1) 1/2" Shrink Tube
iQ-JUMP-6-KIT
(1) 6" Lead wire
(1) 6" Solder
(2) 1" Shrink Tube
(2) 1/2" Shrink Tube

Solder lead wire onto solder pad. Confirm wires are matched up correctly before soldering. See wiring diagrams below for specific light engine details.

NOTE: Recommended soldering iron temperature of 650˚ – 700˚F for lead-free solder.

SW, SC, SW-HE LEAD WIRE
- Red = +24V
- Black = Negative

DW-HE LEAD WIRE
- Black = +24V
- Blue = CW
- Red = WW


RGBW LEAD WIRE
- Blue = Blue
- Red = Red
- Green = Green
- White = White
- Black = +24V

RGB LEAD WIRE
- Black = +24V
- Blue = Blue
- Red = Red
- Green = Green

RGBW-HE LEAD WIRE
- Black = +24V
- Green = Green
- Red = Red
- Blue = Blue
- White = White

3

NOTE:
Connect LED to power supply to ensure it is working properly and all non-factory soldered connections are secure before proceeding with step #3.

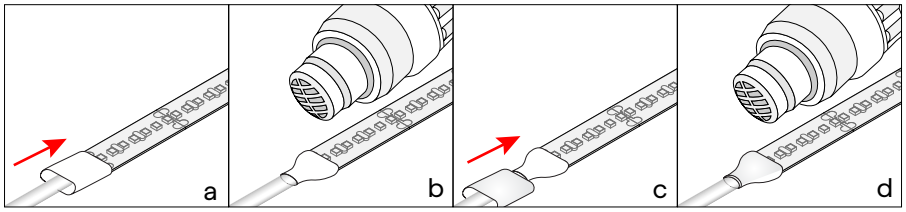

ONCE ALL CONNECTIONS ARE FUNCTIONING PROPERLY, DISCONNECT POWER AND BEGIN HEAT SHRINKING INSTRUCTIONS BELOW:

a: Place 1st sleeve (1/2" Shrink Tube) on lead wire.

b: Shrink the tube with heat gun.

c: Place 2nd sleeve (1" Shrink Tube) on lead wire.

d: Shrink the tube with heat gun.


NOTES:

- *Avoid bending in sharp angles which may damage the LED.*
- *Always test LED operation before installing in extrusion. Connect LED to power supply to ensure it is working properly and all non-factory soldered connections are secure.*
- *Diagrams for representation only and not to scale.*


© 2026 QTL. All rights reserved | 155 Hill St. Milford, CT 06460 | 203-367-8777 | sales@QTL.lighting | QTL.lighting

LED STRIP LEAD WIRE & JUMPER INSTRUCTIONS: **WET IP67**

If LED wires are pre-soldered from the factory, skip to page 6.

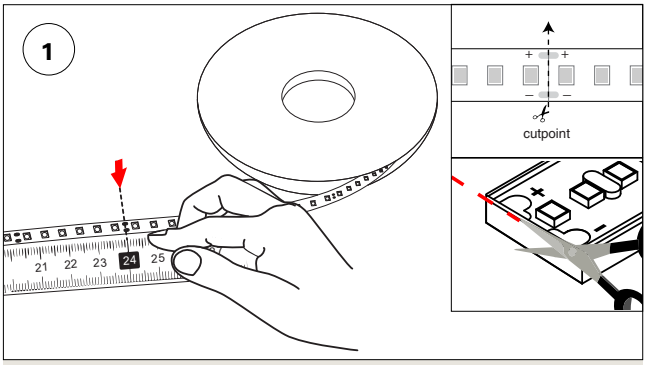


Measure and cut LED strip to desired length with scissors along the cut point.

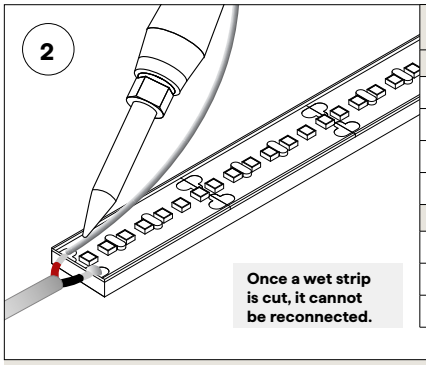

ITEMS INCLUDED
iQ-LED-67-KIT
(1) 24" Lead wire
(1) 6" Solder
(1) Lead wire cap
(1) End Cap
iQ-JUMP-67-KIT
(1) 6" Lead wire
(1) 6" Solder
(2) Lead wire Caps


Solder lead wire onto solder pad. Confirm wires are matched up correctly before soldering. See wiring diagrams below for specific light engine details.

NOTE: Recommended soldering iron temperature of 650˚ – 700˚F for lead-free solder.

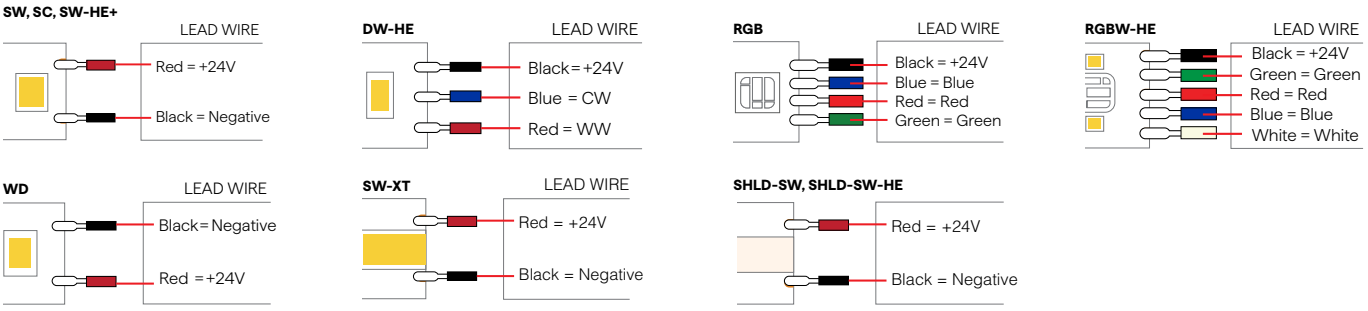

3

NOTE:
Connect LED to power supply to ensure it is working properly and all non-factory soldered connections are secure before proceeding with step #3.

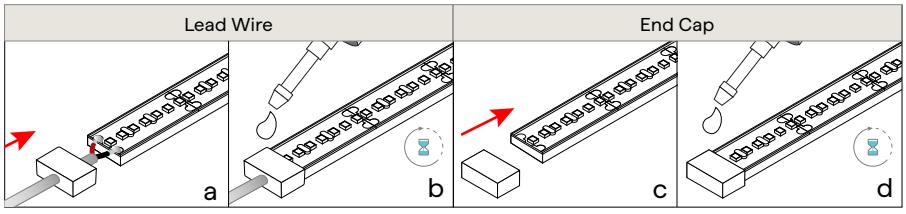

ONCE ALL CONNECTIONS ARE FUNCTIONING PROPERLY, DISCONNECT POWER AND BEGIN HEAT SHRINKING INSTRUCTIONS BELOW:

a: Place lead wire cap over wire

b: Add silicone inside connector and glue around the edge to secure gap; allow time for glue to dry.

c: Place end cap over the end of LED

d: Add silicone inside connector and glue around the edge to secure gap; allow time for glue to dry.


NOTES:

- *Avoid bending in sharp angles which may damage the LED.*
- *Always test LED operation before installing in extrusion. Connect LED to power supply to ensure it is working properly and all non-factory soldered connections are secure.*
- *Diagrams for representation only and not to scale.*

© 2026 QTL. All rights reserved | 155 Hill St. Milford, CT 06460 | 203-367-8777 | sales@QTL.lighting | QTL.lighting


CUTTING EXTRUSIONS FOR IN-FIELD ASSEMBLY INSTALLATION

QTL strongly recommends cutting the extrusion and lens together to achieve a clean cut.

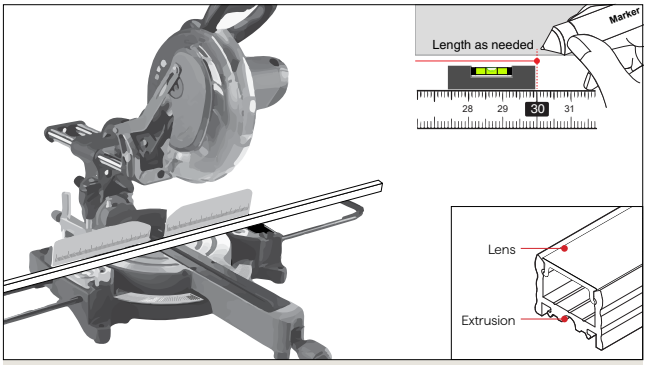

To achieve corners or angles, measure the LED extrusion to desired length and cut with a miter saw.


OR

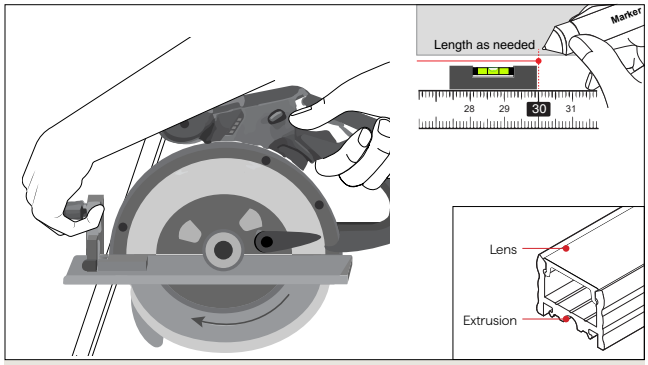


For straight runs, measure LED extrusion to desired length and cut it with a circular saw.

NOTE: Using the proper blade for aluminum, cut to the desired length. Recommend using a 10 in.x 80 tooth medium aluminum saw blade.


CONFIGURATION OPTIONS

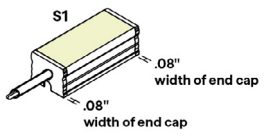


Single End Feed

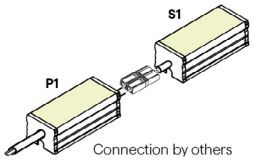


Non-Continuous End Feed

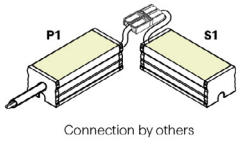

Non-Continuous Corner Feed

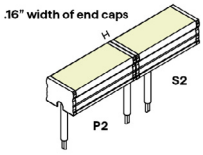

Continuous Bottom Feed

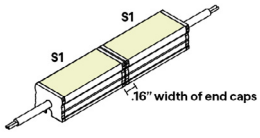

Continuous End to End Feed


Review wire method to ensure clean installation prior to mounting extrusion.

NOTE: Additional wire methods include:
S1, S2: Connector/Wire Input only
P1, P2: Connector/Wire Input and Output


© 2026 QTL. All rights reserved | 155 Hill St. Milford, CT 06460 | 203-367-8777 | sales@QTL.lighting | QTL.lighting

LED INSERTION FOR IN-FIELD ASSEMBLY INSTALLATION


STRIP IN EXTRUSION

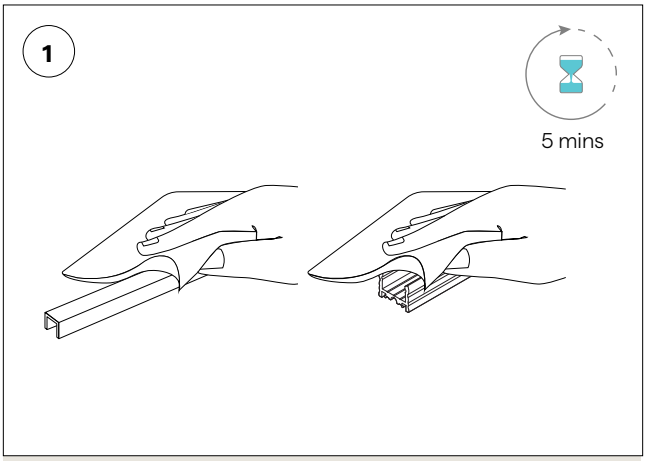


Using a 50/50 alcohol mix, thoroughly clean surface area of the extrusion. Allow 5 minutes to dry.

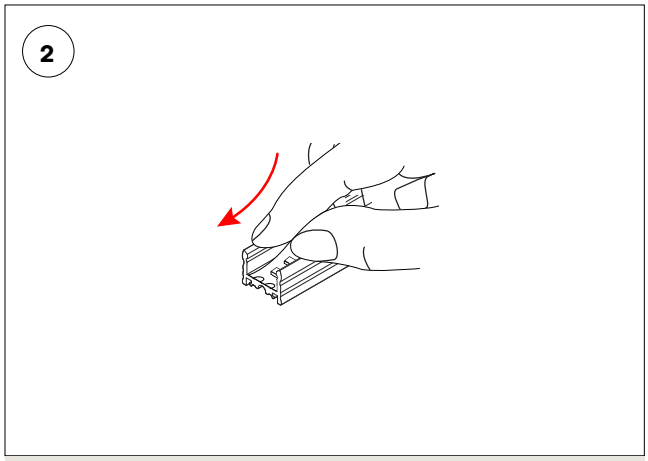

Peel back 0.5" of the VHB tape's protective film on one end of LED and use firm pressure to adhere it to the extrusion, avoiding air bubbles. Continue peeling the film and adhering the strip in small sections until the entire length is installed.

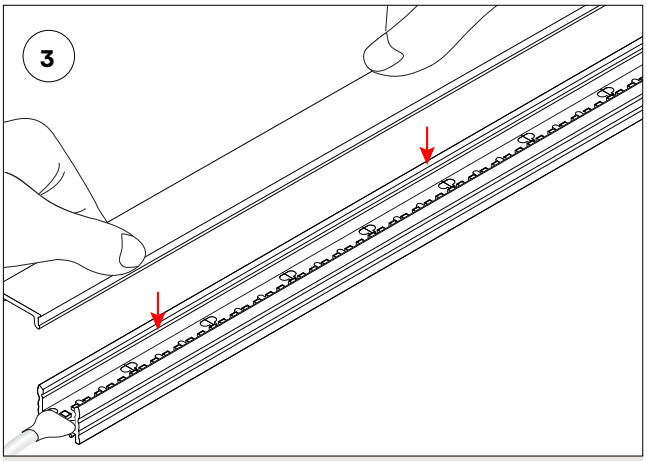

Flat Lenses: Apply uniform pressure until the extrusion and lens snap securely together.

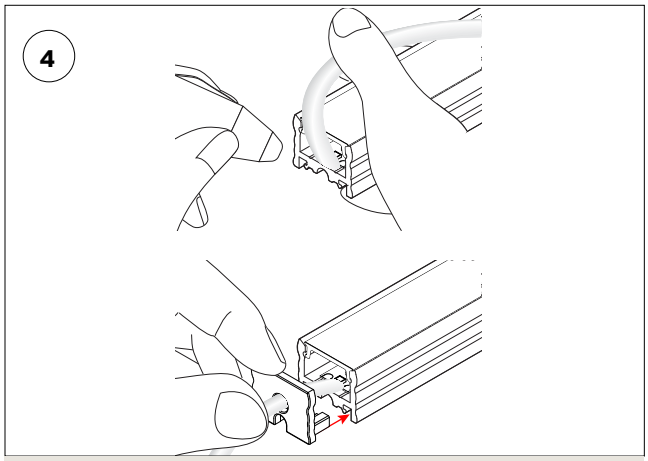


Add glue inside the end cap and glue around edges to secure end cap in place. Do not allow glue to come in contact with LED.


© 2026 QTL. All rights reserved | 155 Hill St. Milford, CT 06460 | 203-367-8777 | sales@QTL.lighting | QTL.lighting

SURFACE MOUNTING METHOD: **SILICONE**

- 2 clips provided for 4’ or less; 4 clips provided for greater than 4’

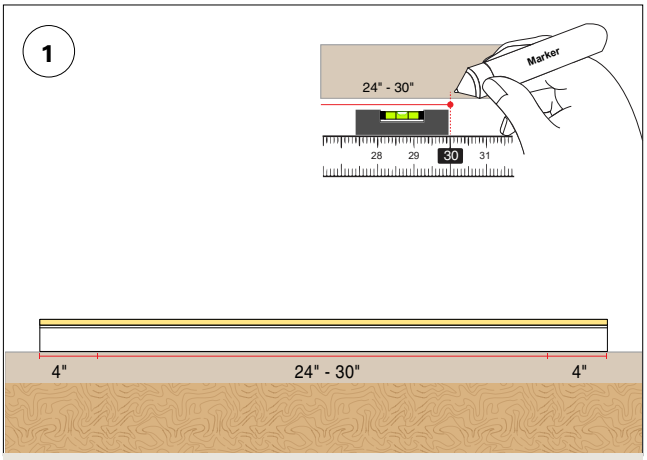

Determine the TALO extrusion(s) location and positioning on desired surface; evenly distribute clips. Make any necessary reference markings to indicate where each clip is to be secured in place. Recommended every 24” - 30”.

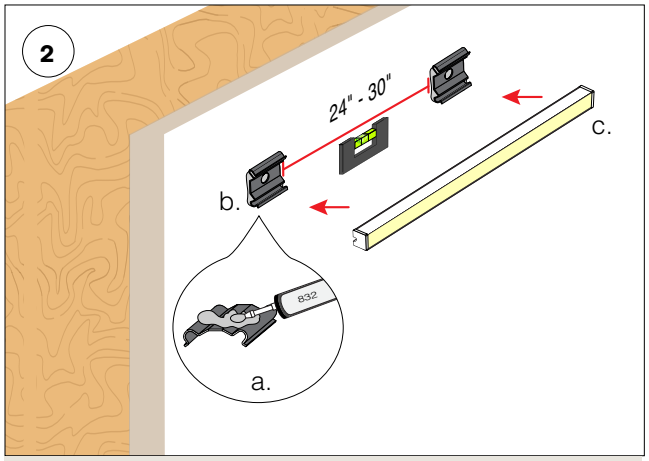


a. Firmly press the silicone-coated clips on the marked reference points.

b. Wait for silicone adhesive to cure completely before snapping extrusion into place.

c. Snap extrusion onto clips.

NOTE: Cure time is dependent on the type of silicone adhesive used. Refer to silicone product manufacturer for accurate drying time.

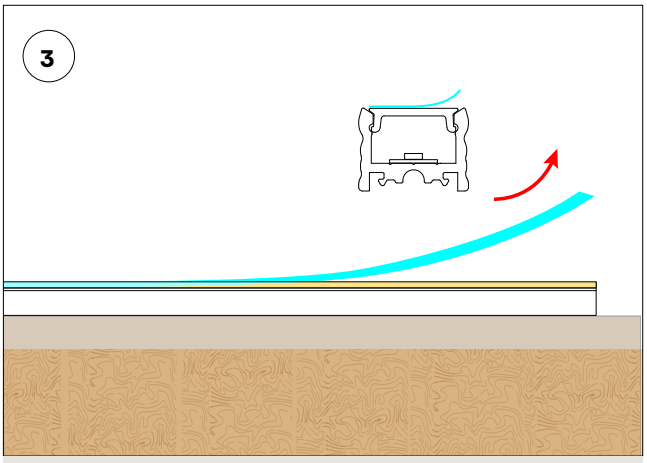


Remove protective film from the surface of the extrusion’s lens.


© 2026 QTL. All rights reserved | 155 Hill St. Milford, CT 06460 | 203-367-8777 | sales@QTL.lighting | QTL.lighting

SURFACE MOUNTING METHOD: **HIDDEN STAINLESS STEEL CLIPS**

- 2 clips provided for 4' or less; 4 clips provided for greater than 4'

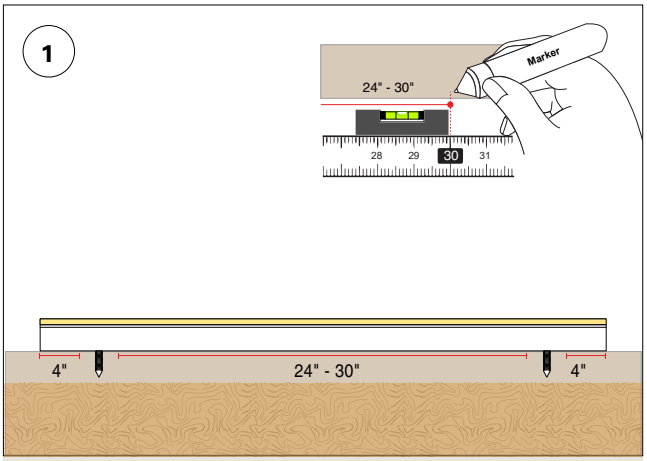

Determine the TALO extrusion(s) location and positioning on desired surface; evenly distribute clips. Make any necessary reference markings to indicate where each clip is to be secured in place. Recommended every 24" - 30".

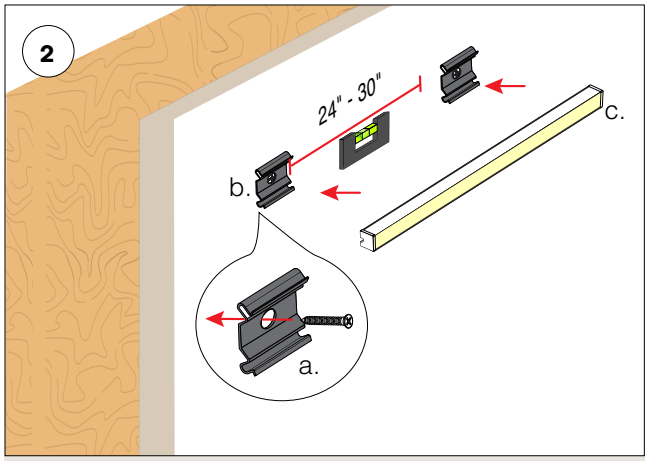


a. Secure clips using the #4 flat head hardware provided.

b. Ensure the screw head is flush with the clip's base.

c. Snap extrusion onto clips.

NOTE: Flat head screw type is dependent on surface/application material. Alternative flat head screws may be required. Refer to the surface material manufacturer for suggested screw type.

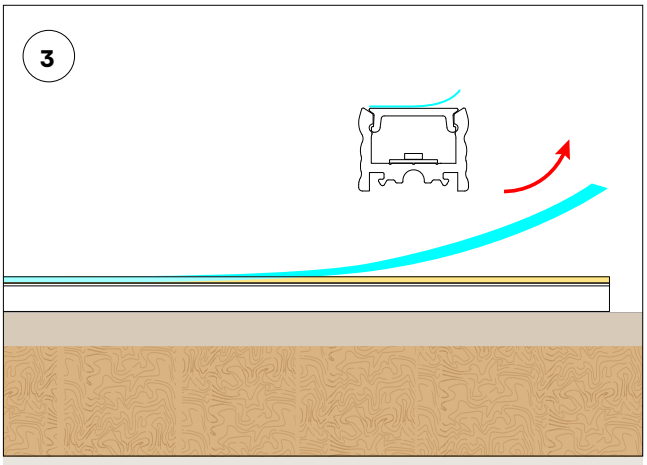


Remove protective film from the surface of the extrusion's lens.


© 2026 QTL. All rights reserved | 155 Hill St. Milford, CT 06460 | 203-367-8777 | sales@QTL.lighting | QTL.lighting

SURFACE MOUNTING METHOD: **PLASTIC T-BAR CLIPS**


- 2 Clips provided per first 12", 1 clip provided per additional foot.

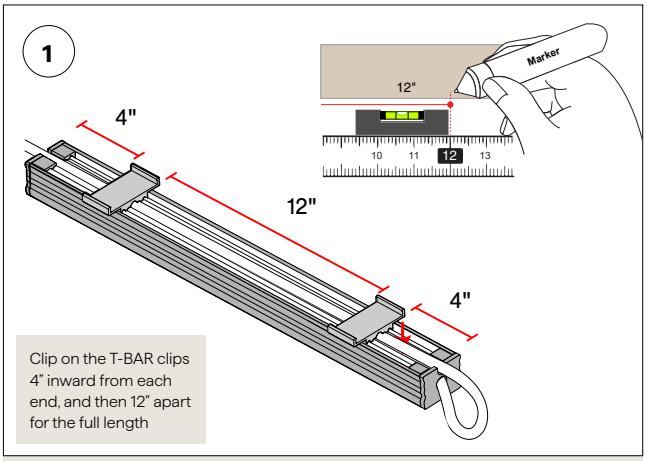

Determine the TALO extrusion(s) location and positioning on desired surface; evenly distribute clips. Make any necessary reference markings to indicate where each clip is to be secured in place. Recommended every 12".

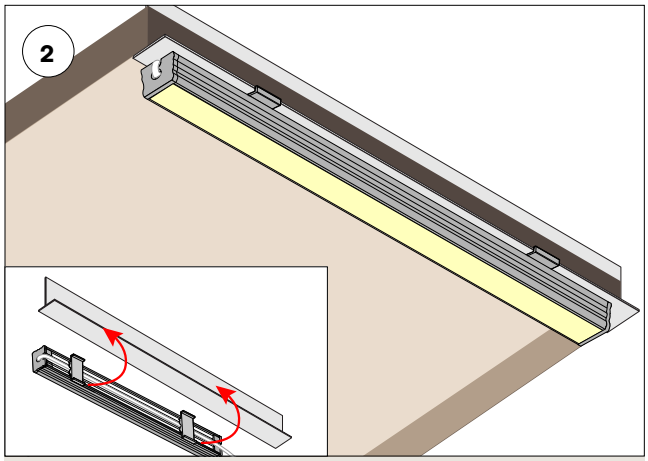

Snap extrusion onto T-BAR.

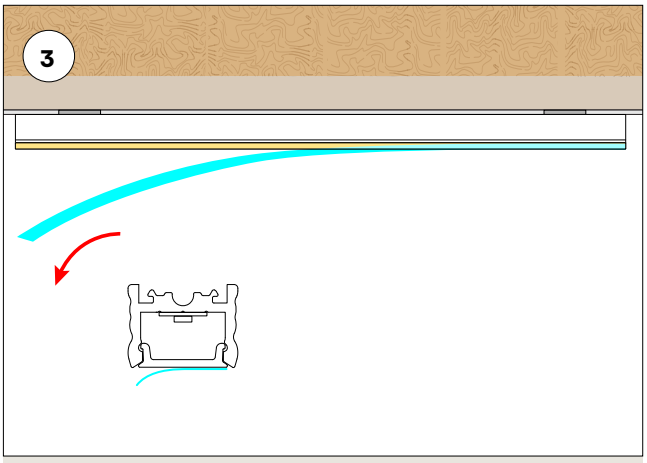

Remove protective film from the surface of the extrusion's lens.


© 2026 QTL. All rights reserved | 155 Hill St. Milford, CT 06460 | 203-367-8777 | sales@QTL.lighting | QTL.lighting

MATERIAL RECYCLING

LINEAR FIXTURES/EXTRUSIONS

You may be done with your products, but chances are they still have more to give. Follow these instructions to break down and sort recyclable components. Check with local recycling collection to ensure they accept the materials listed below.

Additionally, Q-Tran offers a Takeback Program. Contact factory for information.

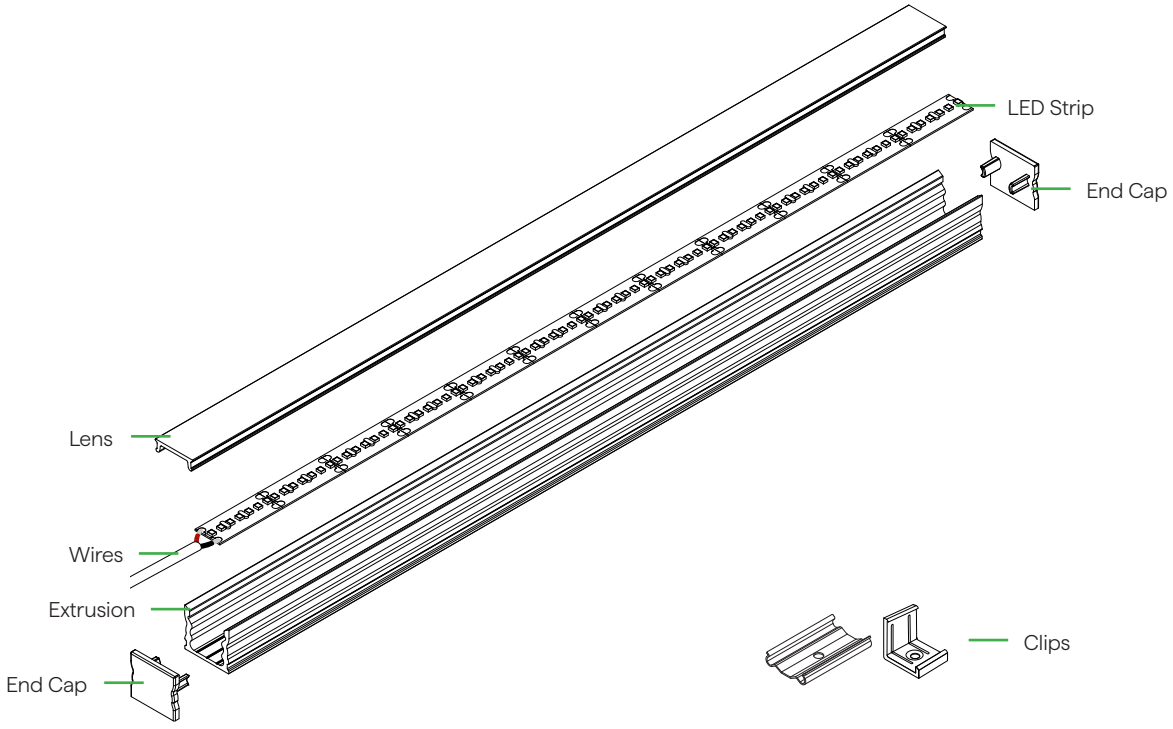

7	E	41	40
Lens Plastic End Caps Plastic Clips	LED Strip Wires	Extrusion Metal End Caps	Stainless Steel Clips

© 2024 QTL. All rights reserved | 155 Hill St. Milford, CT 06460 | 203-367-8777 | sales@QTL.lighting | QTL.lighting